

# Technical Data Sheet

Version 05/2026

## BondTec MS-Multi 275 (MS Kleber)



### Product Description

Solvent-free one-component adhesive based on hybrid polymer. Vulcanizes under the influence of moisture to form a permanently elastic adhesive.

### Standards, tests and specifications

- EN 15651-1: 20HM
- extremely high tensile strength (20 kg/cm<sup>2</sup>)
- EN 13501: Fire behavior class E
- DGNB/ÖGNI: Q4 in line 42 / Q2 in line 13
- GISCODE: RS10



### Product Properties

- for gluing suitable mirrors
- for waterproof bonds
- can be applied on moist substrates
- fire behavior according to EN 13501-1: class E
- not corrosive to metals
- gluing and sealing with the same product
- vibration-dampening
- high stability
- weather, ageing and UV-resistant
- almost odorless
- paintable

## Areas of Application

---

Outdoors, artificial and natural stones. Good adhesion also on Hannoband. Facade construction, window sills, steps, signs, roof area, floorings and skirtings, doors, wall coverings, glass mosaic, metal construction, wood construction, plastic construction, kitchen area, tiles, sanitary area, adhesion of mirrors with suitable mirror coating, repair and reconditioning works. Suitable for combination bonding of different materials. For gluing applications where filling and sealing properties are important.

## Form of Delivery

---

Cartridge:	290 ml
Packing unit:	20 pieces per box

## Substrates

---

### Suitable substrates:

plaster, concrete, aerated concrete, mortar, masonry, brick, clinker, cement, fiber cement, plasterboard, wood, wood chipboard, lacquered, glazed or impregnated wood, wood fiber boards, aluminum, corrosion-protected metals, copper, zinc, ceramics, tiles, mirror, enamel, stoneware, natural stone, polystyrene, glass, many plastics

### Conditionally suitable substrates:

tar and bituminous substrates

### Unsuitable substrates:

EPDM, PIB, PTFE, PP, PE, gypsum, silicone

## Instructions for Use

---

The adhesive surfaces must be clean, dry, free from release agents and firm. Dust, grease, oil and loose parts must be removed before processing. We advise to carry out a suitability test for the large number of substrates, building materials and/or coatings used today, especially for plastics, paintings and powder coatings. Tar and bitumen-containing substrates can lead to color changes of the mass and affect the adhesion.

Cut off the cartridge nipple with a sharp knife. Screw the nozzle onto the cartridge and cut it to the desired width. Insert the cartridge into the ejector gun and apply the adhesive in the form of strings or in a punctiform manner, never on full-faced. Cured adhesive can only be removed mechanically or with solvents.

It is necessary to check whether a subsequent application of paint on the adhesive is compatible. Some paints can lead to changes of the color of the glue and affect the adhesion.

For the processing of large quantities in enclosed areas, sufficient fresh air must be provided during the curing time. The reaction time depends on temperature as well as air and substrate humidity. The final strength of the bond is achieved after several days. If the substrate is extremely moist or by adding extra moisture, the full hardening is accelerated.


Store cartridges cool and dry. Higher temperatures shorten shelf life.

### Use as a mirror adhesive:


Before application, compatibility between the adhesive, the mirror backing or paint coating, and the material to be bonded must be ensured.

For painted glass, the colour shade, layer thickness, opacity and light transmission of the coating must be taken into account. In the case of coatings that are not fully opaque, adhesive beads — including transparent ones — or mounting tapes may be visible on the viewing side.

The adhesive must not be applied in dots or over the full surface, but in vertical beads. The adhesive beads must be applied in accordance with the following sketch. After pressing the glass or mirror into place, the width of the adhesive beads should not exceed 10 mm. To ensure safe load transfer, a sufficient bonding area must be provided; as a guideline, at least 10 cm<sup>2</sup> of bonding area per kg of glass or mirror weight is required, unless otherwise specified by the mirror manufacturer

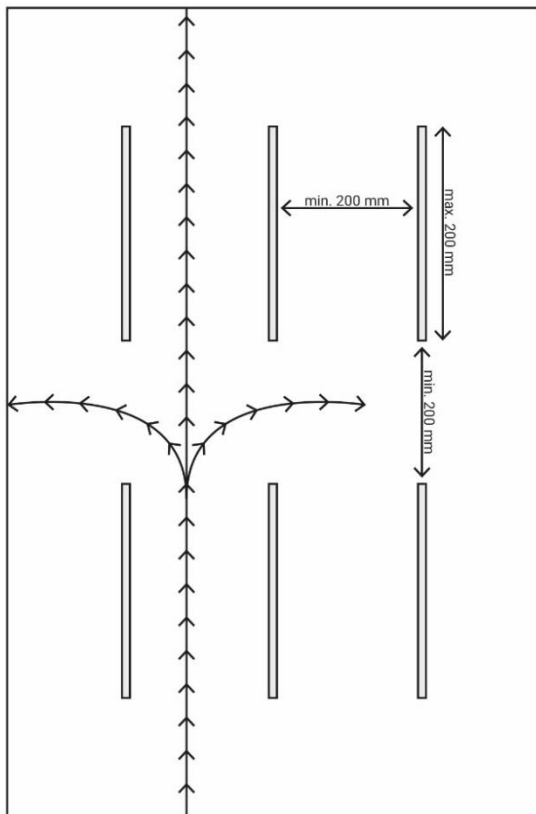

Correct

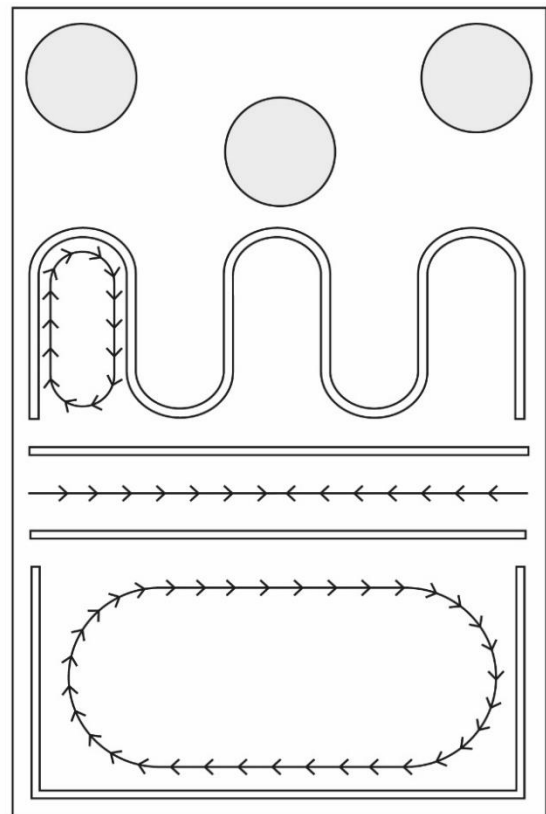

Incorrect

Adequate rear ventilation must be ensured between the mirror or glass and the substrate. The ventilation gaps must comply with EN 1036 (min. 5 mm). Smaller gaps may only be used in areas without additional moisture exposure and at the installer's own responsibility.

Until sufficient curing has been achieved, the element must be secured against slipping or tilting. The bond may only be subjected to load after sufficient through-curing; for this purpose, a minimum period of 48 hours must be allowed (23 °C, approx. 50–55% RH)

The processing instructions of the mirror manufacturer, ÖNORM EN 1036 – Annex B, and the Technical Guidelines of the Glazing Trade No. 11, Installation of Mirrors, must be observed.

## Technical Data

Characteristics	Standard	Value
Density	EN 1183-1	1,5 ± 0,1 g/cm <sup>3</sup>
Shore A hardness	EN ISO 868	approx. 55
Fire behavior	EN 13501-1	class E
Skin formation time (normal climate 23/50)		approx. 10 min
Curing (normal climate 23/50, depending on substrate)		approx. 2 mm/day
Tensile load (adhesive strength 0.5-1 mm after 3 days)		approx. 2 N/mm <sup>2</sup>
Temperature resistance (cured mass)		-20 to +90 °C
Processing temperature		+5 to +40 °C
Shelf life (dry, at +10 to +25 °C)		12 months

## Safety Instructions

Please refer to our safety data sheet and the product label for further information on product safety and handling. Current safety data sheets and further information on our products can be found at [www.insebo.com](http://www.insebo.com).

## Service

Upon request, our trained sales representatives are always at your disposal.

## Disposal

For disposal instructions please refer to our safety data sheet and product label.

## **Additional Information**

---

This technical data sheet advises without obligation and guarantee. The mentioned processing instructions have to be adapted to the prevailing conditions. The user is obliged to check the suitability and application by own experiments in order to avoid failures.

All given descriptions, data, ratios, weights, etc. can change without notice and do not represent contractually agreed properties of the product. Existing laws, standards and regulations are to be observed by the recipient of our products in their own responsibility.

Due to the large number of possible influences during processing and application, a guarantee of certain properties or suitability for a specific application can not be made, own tests are necessary.

The right to make technical changes is reserved.